



TECH BULLETIN

TECH BULLETIN NUMBER 0133

PCR 06192007-MS4448-SW 3-4

SUBJECT Charger defaults with no remote

MODELS AFFECTED MS4448-AE

REPAIR PROCEDURE Update control board

WARRANTY Standard warranty applies

 Please call for an RMA

Was:	Is:	Implication:
v3.3	v3.4	
No Charge Without Remote, Shore Amps and Charge Amps both defaulted to 0 Amps	Fixed default to equal full charge rate and 60 amps Shore power, without remote installed.	Unit will charge without a remote
EQ for AGM1 60VDC	EQ for AGM1 62VDC	Charge value is more appropriate for this profile.