



## **TECH BULLETIN**

**TECH BULLETIN NUMBER: 0114**

**DATE: April 5, 2005**

**Subject: Search mode "Internal Fault"**

**Models affected: All MS models**

Some MS models will display "Internal Fault" in Search Mode only. A resister change was made to eliminate this fault. Changing the "Search watts" to "disabled" in the setting mode will also eliminate this fault.

If this fault is detected and it is not desirable to use the "disabled" setting in Search Mode then the control board should be replaced with a new part dated coded after 4-5-05. R48 on the control board was changed from 20K to 4.99K

Magnum Energy Inc.  
Tech Service Dept.